



Daily Construction Report

Date 4/4/14

Day	S	M	T	W	T	F	S
						X	

Project	Budnick Way - Boxford, MA
Project No.	06524.03
Client	Boxford Planning Board
Contractor	
Project Manager	Tim McIntosh

Weather	Sun X	Cloudy	Overcast	Rain	Snow
Temp.	To 32	32-50 X	50-70	70-85	85 & Over
Wind	Still	Moderate X	High	Report No.	
Humidity	Dry X	Moderate	Humid	3	

Average Field Force

Name of Contractor	Non-manual	Manual	Remarks
			No construction personnel on site.

Visitors

Time	Name	Representing	Remarks
8:10 AM	Jack Lydon	VHB	On site to verify that all work has been completed
8:30 AM	Ross Povenmire	Boxford Conservation Commission	

Equipment at the Site

No Equipment on site

Construction Activities:

I arrived on site at 8:10 AM at the request of Boxford Planning Board to verify that all work has been completed. Below are my observations:

- Stockpiles were removed from cul-de-sac area
- Wooden guard rail had been installed along a portion of lower driveway to Lot #1.
- Water Tank access hatch had been installed.
- Most of the property bounds were installed. Unable to locate/verify all bounds
 - Approximate STA 0+00 RT - NO property bound found. -Found Railroad spike installed at base of large tree
 - Approximate STA 1+50 RT - NO property bound found. -Found painted rock (drill hole not found)
 - Approximate STA 2+90 LT - STA 0+00 RT - NO property bound found. May have been covered with fallen tree
- It appears that seven pine trees were installed along the right side of Lauren Way from approximate STA 0-60 to 0+00 RT. One tree was dead and should be replaced
- Hot mix asphalt top course was not installed. Prior to placing top course replace 30" x 13' damaged binder at driveway #1. Remove grass and seal multiple (sawcut lines) pavement joints for underground utilities and water tank. Sweep roadway surface clean and apply tack coat prior to placing HMA top course.
- Remove large fallen tree and branches along left side of cul-de-sac.

THIS REPORT CONTINUED

By: Jack Lydon, P.E. Title: Construction Inspector

Vanasse Hangen Brustlin, Inc.

Consulting Engineers and Planners
101 Walnut Street, P.O. Box 9151
Watertown, MA 02471-9151
617-924-1770

Daily Construction Report

(Continuation Sheet)

Project Budnick Way - Boxford, MA Report No. 3

Job No. 6524.03 Date 4/4/14

Construction Activities:

- 8. Vegetation immediately adjacent to the headwall at approximate road station 1+20 LT within BMP#2 needs to be removed.
- 9. The rim of leaching basin #2 needs to be lowered and shoulder area regraded to eliminate standing water in the vicinity. Remove silt sack.
- 10. Eliminate any invasive species in stormwater detention areas.
- 11. Remove sedimentation barrier located at cul-de-sac.
- 12. Provide "As-Built" drawings.
- 13. Clean drainage structure.

Left site @ 10:20 AM

END OF THIS REPORT

- DISTRIBUTION:
- 1. Proj. Mgr.
 - 2. Field Office
 - 3. File
 - 4. Client

BY Jack Lydon, P.E. TITLE Construction Inspector

